



SCOTT EQUIPMENT

HEAVY-DUTY COMMITMENT

Scott Equipment Company, LLC
140 Waldron Rd.
Laverge, TN 37086
Ph: 615-793-3888 • Fax: (615) 793-9655
www.scottcompanies.com

Ship to:

THORNE'S EXCAVATING CO
1852 Sparta Pike
Lebanon, TN 37090

Invoice to:

THORNE'S EXCAVATING CO
624 OLD HORN SPRINGS RD
LEBANON TN 37087

Attention: MARK THORNE

Branch NASHVILLE		
Date 06/21/23	Time 10:48:06 (O)	Page 01
Account No. THORN006	Phone No. 6154445142	Invoice No. X44185
Ship Via		Purchase Order
Sales Tax License No.		Federal Exemption No.
		Salesperson SS5

DESCRIPTION

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
232267	EC380EL VOLVO	2945	VCEC380EK00314490	01/05/22	2500 FM
	EC380		980936	01/05/24	6000 PR

SEGMENT# 1 S K3001 NA 06/09/23 06/09/23 06/30/23

Fan belt shredded

COMPLAINT:
Fan belt shredded
this repair not related to previous repair in April. Clamp came loose and fluid leaked on belt causing issue.

CAUSE:
Clamp loose. Bad oring. Belt blown.

CORRECTION:
Drove to the job site. Waited for customer to open the gate. Began inspecting machine. Removed the hood and engine cover. Cleaned the oil and coolant from around the belts to see what's leaking. leaking from a hose and caused belt to break. Found a loose clamp and a bad O-ring. belt is broken as well. Ordered parts. Arrived back on jobsite. Cleaned up area where oil and coolant is leaking onto the belt. Replaced and tighten the clamp down. replaced the o ring. Let unit run for over one hour. Had no visible leaks. Installed new belt and checked the pulleys. filled oil to appropriate levels. Machine is running properly. No other needs at this time.


#0517

ADDITIONAL DESCRIPTION:
James - 6154447970
1852 Sparta Pike, Lebanon, TN 37090
Said go towards the sawmill

CONTINUED ON PAGE 02

SCOTT EQUIPMENT COMPANY, LLC TERMS:
PAYABLE ON THE 10th OF MONTH FOLLOWING MONTH OF PURCHASE.
ALL ACCOUNTS NOT PAID IN FULL BY THE DUE DATE MAY BE SUBJECT TO A LATE CHARGE UP TO THE MAXIMUM AMOUNT ALLOWED BY STATE LAW.
CREDIT CARD PAYMENTS ARE SUBJECT TO A 3% CONVENIENCE FEE.

SIGN _____ RECEIVED BY _____

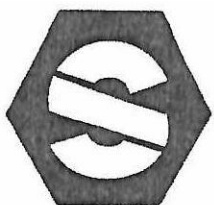

SCOTT EQUIPMENT

HEAVY-DUTY COMMITMENT

Scott Equipment Company, LLC

140 Waldron Rd.
Lavergne, TN 37086
Ph: 615-793-3888 • Fax: (615) 793-9655
www.scottcompanies.com

Ship to:

THORNE'S EXCAVATING CO
1852 Sparta Pike
Lebanon, TN 37090

Invoice to:

THORNE'S EXCAVATING CO
624 OLD HORN SPRINGS RD
LEBANON TN 37087

Attention: MARK THORNE

Branch NASHVILLE			
Date 06/21/23	Time 10:48:06 (O)	Page 02	
Account No. THORN006	Phone No. 6154445142	Invoice No. X44185	
Ship Via		Purchase Order	
Sales Tax License No.		Federal Exemption No.	
		Salesperson SS5	

DESCRIPTION

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS	
232267	EC380EL VOLVO	2945	VCEC380EK00314490	01/05/22	2500	FM
	EC380		980936	01/05/24	6000	PR
17418267	Belt			1	85.02	85.02
					PARTS	85.02
					LABOR	1101.23
10400089	10501089			SEGMENT TOTAL==>		1186.25

***** WORK ORDER TOTALS *****

PARTS	85.02
LABOR	1101.23
DISPOSAL FEE	25.00
ENVIRONMENT FEE	25.00
HAULING	200.00
SUPPLIES	77.08
SUB TOTAL==>	1513.33
TN STATE TAX 7.00%	105.93
LAVERGNE 2.75%	41.62
CUSTOMER TOTAL	1660.88

SCOTT EQUIPMENT COMPANY, LLC TERMS:

PAYABLE ON THE 10th OF MONTH FOLLOWING MONTH OF PURCHASE.
ALL ACCOUNTS NOT PAID IN FULL BY THE DUE DATE MAY BE SUBJECT TO A LATE CHARGE UP TO
THE MAXIMUM AMOUNT ALLOWED BY STATE LAW.
CREDIT CARD PAYMENTS ARE SUBJECT TO A 3% CONVENIENCE FEE.

SIGN _____

RECEIVED BY _____

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0517
 MAKE Volvo
 MODEL EC380
 SERIAL # _____
 HOUR METER 1500 HRS
 MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____
 REASON _____
 PARTS _____ LABOR _____
 OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS
 POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER
 OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED
 OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH
 SMOKES SHORTED VIBRATE OTHER _____

DATE 5-2-22 DATE COMPLETED 5-3-22
 MECHANIC Ben

JOB NAME/LOCATION

Ruthen

JOB NUMBER

PROBLEM: Service

REPAIRED: serviced

PARTS: Oil, fuel & Engine Air filters 326.³⁰ Scott Equipment

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION		EQUIPMENT DOWNTIME	COMPONENT CODES	
EQUIP. # <u>0517</u>	MAKE <u>Volvo</u>	HOURS _____ DAYS _____	BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS	
MODEL <u>EC350</u>		REASON _____	POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED	
SERIAL # _____	HOUR METER _____	PARTS _____ LABOR _____	COMPONENT LOCATION	
MILES _____		OTHER _____	FRONT REAR LEFT RIGHT UPPER LOWER	
REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED		DATE: _____	DATE COMPLETED <u>8-11-22</u>	
OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH		MECHANIC <u>Anthony</u>	JOB NAME/LOCATION <u>West Trinity</u>	
SMOKES SHORTED VIBRATE OTHER _____		JOB NUMBER _____		
PROBLEM: <u>broken Air duct Adapter</u>				
REPAIRED: <u>replaced Adapter</u>				
PARTS: <u>Adapter</u> <u>346.54</u> <u>Scott Equipment</u>				

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # #0517

MAKE Valco

MODEL EC380

SERIAL # _____

HOUR METER 2K HRS

MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____

REASON _____

PARTS _____

LABOR _____

OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS
POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER

OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED

OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH

SMOKES SHORTED VIBRATE OTHER _____

DATE: 8-31-22 DATE COMPLETED 9-17-22

MECHANIC Anthony & Brian

JOB NAME/LOCATION
West Trinity

JOB NUMBER _____

PROBLEM: Service

REPAIRED: Serviced

PARTS: Filters 1191.52 Scott Equipment

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0517

MAKE Volvo

MODEL EC380

SERIAL # _____

HOURLY METER _____

MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____

REASON

PARTS _____ LABOR _____

OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS

POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER

OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED

OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH

SMOKES SHORTED VIBRATE OTHER _____

DATE: _____ DATE COMPLETED 1-26-23

MECHANIC Ben

JOB NAME/LOCATION

Anthem

JOB NUMBER

PROBLEM: Track pad bolts

REPAIRED: _____

PARTS: 24 bolts + nuts

Scott Equipment

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0517

MAKE Volvo

MODEL EC380

SERIAL # _____

HOURLY METER 2500 HRS

MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____

REASON _____

PARTS _____ LABOR _____

OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS

POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER

OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED

OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH

SMOKES SHORTED VIBRATE OTHER _____

DATE 2-14-23 DATE COMPLETED 2-15-23

MECHANIC Anthony

JOB NAME/LOCATION

Anthom

JOB NUMBER

PROBLEM: Service

REPAIRED: serviced

PARTS: Filters 371.5P Scott Equipment

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0517
 MAKE Volvo
 MODEL EC380
 SERIAL # _____
 HOUR METER 2714 HRS
 MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____
 REASON _____
 PARTS _____ LABOR _____
 OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS
 POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER
 OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED
 OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH
 SMOKES SHORTED VIBRATE OTHER _____

DATE: _____ DATE COMPLETED 4-14-23

MECHANIC Scott

JOB NAME/LOCATION

JOB NUMBER

Antler

PROBLEM: Hydraulic Fan down

REPAIRED: Scott Equipment replaced fan brought to shop worked

PARTS: parts & labor
2-Teeth & locks

5585.96

Scott Equipment
Scott Equipment

TEC

THORNE'S EXCAVATING COMPANY, LLC
SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 05717

MAKE Volvo

MODEL EC380

SERIAL # _____

HOUR METER 3k HRS

MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____

REASON _____

PARTS _____

LABOR _____

OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS

POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER

OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED

OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH

SMOKES SHORTED VIBRATE OTHER _____

DATE: 6-26-23 DATE COMPLETED 6-27-23

MECHANIC Anthony J. Justin

JOB NAME/LOCATION

Sparks PK

JOB NUMBER

PROBLEM: Service

REPAIRED: Serviced

PARTS: Filters

609, 49

Scott Equipment

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0517
 MAKE Volvo
 MODEL EC 380
 SERIAL # _____
 HOUR METER 3,300 HRS
 MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____
 REASON _____
 PARTS _____ LABOR _____

OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS
 POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER

OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED
 OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH
 SMOKES SHORTED VIBRATE OTHER _____

DATE 8-23-23 DATE COMPLETED 10-18-23

MECHANIC Ben & Scott Equipment

JOB NAME/LOCATION

Sparks PK

JOB NUMBER

PROBLEM: running hot pushing out antifreeze
Scott Equipment working on it,

REPAIRED: removed engine new injectors & cups.
Engine inspected by Scott Equipment, Engine
installed by Scott Equipment,
Replaced thermostats.
new oil & filter & fuel filters

PARTS: Thermostat
Scott Equipment

215.25

Scott Equipment

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0517
 MAKE Volvo
 MODEL EC380
 SERIAL # _____
 HOUR METER _____
 MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____
 REASON _____
 PARTS _____ LABOR _____
 OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS
 POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER

OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED
 OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH
 SMOKES SHORTED VIBRATE OTHER _____

DATE: _____ DATE COMPLETED 2-1-24

MECHANIC Bryan

JOB NAME/LOCATION

JOB NUMBER

New Shop

PROBLEM: one bad batteries

REPAIRED: replaced batteries

PARTS: 2-8D batteries 520.10

Interstate battery

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0517

MAKE Valvo

MODEL EC380

SERIAL # _____

HOURLY METER _____

MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____

REASON

PARTS

LABOR

OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS

POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER

OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED

OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH

SMOKES SHORTED VIBRATE OTHER _____

DATE: _____ DATE COMPLETED 3-28-24

MECHANIC Ben

JOB NAME/LOCATION

Ben 41st Ave.

JOB NUMBER

PROBLEM: broken fan belt

REPAIRED: replaced belts

PARTS: belts

186.05

Scott Equipment

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0517

MAKE Valvo

MODEL EC380

SERIAL # _____

HOUR METER 3,500 HRS

MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____

REASON

PARTS _____ LABOR _____

OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS

POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER

OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED

OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH

SMOKES SHORTED VIBRATE OTHER _____

DATE: 4-17-24 DATE COMPLETED 4-19-24

MECHANIC Anthony

JOB NAME/LOCATION

Windlands East

JOB NUMBER

PROBLEM: Service

REPAIRED: serviced

PARTS:

A: Here

393.01

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0517

MAKE Volvo

MODEL EC380

SERIAL # _____

HOURLY METER _____

MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____

REASON

PARTS _____ LABOR _____

OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS

POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER

OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED

OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH

SMOKES SHORTED VIBRATE OTHER _____

DATE: _____ DATE COMPLETED 5-28-14

MECHANIC Anthony

JOB NAME/LOCATION Wineland East JOB NUMBER _____

PROBLEM: shred belt.

REPAIRED: replaced belt

PARTS: belt 99.75 Scott Equipment

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0517
 MAKE Volvo
 MODEL EC380
 SERIAL # _____
 HOUR METER _____
 MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____
 REASON
 PARTS _____ LABOR _____
 OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS
 POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER

OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED
 OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH
 SMOKES SHORTED VIBRATE OTHER _____

DATE: _____ DATE COMPLETED 6-26-24

MECHANIC Anthony

JOB NAME/LOCATION Windlands JOB NUMBER CR10

PROBLEM: hose blower

REPAIRED: replaced Top Radiator hose

PARTS hose
belt

179.75
99.76

Scott Equipment
Scott Equipment

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0517

MAKE Volvo

MODEL EC380

SERIAL # _____

HOUR METER _____

MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____

REASON

PARTS

LABOR

OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS

POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER

OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED

OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH

SMOKES SHORTED VIBRATE OTHER _____

DATE: _____ DATE COMPLETED 7-8-24

MECHANIC Ben & Anthony

JOB NAME/LOCATION Windland East

JOB NUMBER _____

PROBLEM: Alt. belt broken

REPAIRED: replaced belt.

Need to bring to shop

PARTS: Alt. belt

86.28

James

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0517

MAKE Volvo

MODEL EC380

SERIAL # _____

HOUR METER 3,670 HRS

MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____

REASON

PARTS

LABOR

OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS

POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER

OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED

OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH

SMOKES SHORTED VIBRATE OTHER _____

DATE: 7-26-24 DATE COMPLETED 7-31-24

MECHANIC Anthony

JOB NAME/LOCATION

JOB NUMBER

Shop

PROBLEM: pulley & belts

REPAIRED: replaced pulley & belts

PARTS: pulley
belts

525.¹⁹
106.⁰⁵

Scott Equipment

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 05717

MAKE Volvo

MODEL EC350

SERIAL # _____

HOUR METER _____

MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____

REASON

PARTS

LABOR

OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS

POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER

OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED

OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH

SMOKES SHORTED VIBRATE OTHER _____

DATE: 9-10-24 DATE COMPLETED _____

MECHANIC Ben & Anthony

JOB NAME/LOCATION

Spinto Pk

JOB NUMBER

PROBLEM: destroyed alt, w. pump belt

REPAIRED: cleared all pulleys, removed alt. & cleared replaced leaking hose. new belt.

PARTS:	<u>pulley, bearing & belt</u>	<u>417.³⁶</u>	<u>Scott Equipment</u>
	<u>hose</u>	<u>251.⁹⁶</u>	<u>Scott Equipment</u>
	<u>clamps & hose</u>	<u>341.⁰⁰</u>	<u>Scott Equipment</u>

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION EQUIP. # <u>0517</u> MAKE <u>Volvo</u> MODEL <u>EC 380</u> SERIAL # _____ HOUR METER _____ MILES _____	EQUIPMENT DOWNTIME HOURS _____ DAYS _____ REASON _____ PARTS _____ LABOR _____ OTHER _____	COMPONENT CODES BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED COMPONENT LOCATION FRONT REAR LEFT RIGHT UPPER LOWER OTHER _____		
REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH SMOKES SHORTED VIBRATE OTHER _____		DATE: _____ DATE COMPLETED <u>9-23-24</u> MECHANIC <u>Ben</u> <table border="1" style="width:100%; border-collapse: collapse;"> <tr> <td style="width:50%;">JOB NAME/LOCATION <u>New Shop</u></td> <td style="width:50%;">JOB NUMBER</td> </tr> </table>	JOB NAME/LOCATION <u>New Shop</u>	JOB NUMBER
JOB NAME/LOCATION <u>New Shop</u>	JOB NUMBER			
PROBLEM: <u>bad alternator</u> 				
REPAIRED: <u>replaced alternator & belt.</u> 				
PARTS: <u>Alternator</u> <u>291.10</u> <u>ATB Electric</u> 				

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0517
MAKE Volvo
MODEL EC380
SERIAL # _____
HOUR METER _____
MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____
REASON _____
PARTS _____ LABOR _____
OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS
POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER
OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED
OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH
SMOKES SHORTED VIBRATE OTHER _____

DATE: _____ DATE COMPLETED 10-1-24

MECHANIC Bryan

JOB NAME/LOCATION

New Shop

JOB NUMBER

PROBLEM: reman. alternator west bad.

REPAIRED: replaced alt. & belt

PARTS: Alt belt 87.24

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0517

MAKE Volvo

MODEL EC380

SERIAL # _____

HOURLY METER 4K HRS

MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____

REASON

PARTS

LABOR

OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS

POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER

OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED

OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH

SMOKES SHORTED VIBRATE OTHER _____

DATE 11-26-24 DATE COMPLETED 11-27-24

MECHANIC Anthony & Justin

JOB NAME/LOCATION

JOB NUMBER

Sparta PK

PROBLEM: service

REPAIRED: serviced

replaced coolant line on side of engine

PARTS: Fitters

have

737.85

16.69

Scott Equipment
O'Reilly Auto Parts

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0517
 MAKE Volvo
 MODEL EC380
 SERIAL # _____
 HOUR METER 4K HRS
 MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____
 REASON _____
 PARTS _____ LABOR _____
 OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS
 POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER
 OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED
 OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH
 SMOKES SHORTED VIBRATE OTHER _____

DATE: 1-13-25 DATE COMPLETED 1-10-25
 MECHANIC All

JOB NAME/LOCATION

JOB NUMBER

New Shop

PROBLEM: Service

REPAIRED: serviced

PARTS:

filters

657.16

Scott Equipment

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION		EQUIPMENT DOWNTIME		COMPONENT CODES	
EQUIP. # <u>0517</u>		HOURS _____ DAYS _____		BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS	
MAKE <u>Volvo</u>		REASON		POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED	
MODEL <u>EC380</u>		PARTS _____ LABOR _____		COMPONENT LOCATION	
SERIAL # _____		OTHER _____		FRONT REAR LEFT RIGHT UPPER LOWER	
HOUR METER _____				OTHER _____	
MILES _____					
REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED				DATE: _____ DATE COMPLETED <u>1-31-25</u>	
OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH				MECHANIC <u>Bryce</u>	
SMOKES SHORTED VIBRATE OTHER _____				JOB NAME/LOCATION <u>Shop</u>	
				JOB NUMBER _____	
PROBLEM: <u>Hole in Top Radiator hose</u>					
REPAIRED: <u>replaced hose</u>					
PARTS: <u>Hose</u> <u>185.94</u> <u>Scott Equipment</u>					

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 05717
 MAKE Volvo
 MODEL EC380
 SERIAL # _____
 HOUR METER _____
 MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____
 REASON _____
 PARTS _____ LABOR _____
 OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS
 POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER
 OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED
 OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH
 SMOKES SHORTED VIBRATE OTHER _____

DATE: 3-13-25 DATE COMPLETED 3-18-25

MECHANIC _____

JOB NAME/LOCATION Wilcox Judicial JOB NUMBER _____

PROBLEM: broken latch & striker

REPAIRED: replaced latch & striker

PARTS: Striker 68.26 Scott Equipment
latch 580.59 Scott Equipment

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 05717
 MAKE Volvo
 MODEL EC380
 SERIAL # _____
 HOUR METER 4500 HRS
 MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____
 REASON _____
 PARTS _____ LABOR _____

OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS
 POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER

OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED
 OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH
 SMOKES SHORTED VIBRATE OTHER _____

DATE 3-29-25 DATE COMPLETED 4-3-25

MECHANIC Brycen

JOB NAME/LOCATION

Wilson Judicial

JOB NUMBER

PROBLEM: Service

REPAIRED: Serviced

PARTS: filters oil & fuel 329.65 Scott Equipment
hose 1789.59 Nashville Rubber

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION		EQUIPMENT DOWNTIME		COMPONENT CODES	
EQUIP. # <u>0517</u>		HOURS _____ DAYS _____		BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS	
MAKE <u>Volvo</u>		REASON _____		POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED	
MODEL <u>EC380</u>		PARTS _____ LABOR _____		COMPONENT LOCATION	
SERIAL # _____		OTHER _____		FRONT REAR LEFT RIGHT UPPER LOWER	
HOUR METER <u>SK AKS</u>				OTHER _____	
MILES _____					
REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED				DATE <u>10-13-25</u> DATE COMPLETED <u>10-17-25</u>	
OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH				MECHANIC <u>Ben</u>	
SMOKES SHORTED VIBRATE OTHER _____				JOB NAME/LOCATION	
				<u>TCAT</u>	
				JOB NUMBER	
PROBLEM: <u>Service</u>					

REPAIRED: Serviced

PARTS: <u>Filters</u>	<u>1269.²⁵</u>	<u>Scott Equipment</u>
<u>3 filters</u>	<u>374.⁶⁰</u>	<u>Scott Equipment</u>