


64962

Date: <u>June 19/25</u> Unit: <u>02-39</u> S/N: _____ Mileage: <u>1342703</u> Hours: <u>31475</u>			
Frame/Chassis & Body	OK Attended To	Brake/Wheel/Hub & Air	OK Attended To
Fuel Tanks & Cap		Brake Friction Components	✓ JM
Fifth Wheel/Trailer Connecting Devices		Air Brake Components	✓ JM
Decals (GVW, Tare, Logo)		Air Dryer/Air Hoses/Air Fittings	✓ JM
Body		Brake Pedal	✓ JM
Doors, Latches		Air Brake System	✓ JM
Mud Flaps		Parking Brake	
Windshield, Windows, Mirrors		Emergency Brake	
Check Underbody		Service Brake	
Hangar Brackets		Wheel Bearing	
Frame		Set Brakes & Check Operation	✓ MF/JM/DVO/65
Bumpers & Fenders		Drive Train/Transmission & Diff.	OK Attended To
Tires	OK Attended To	U Joints	
Depth of Tread		Transmission Level/Hoses	✓ MF
Tread Defects		Transmissions/Differentials	
Sidewall Defects		Check Linkages	
Recapping		Drive Shaft	
Sidewall Defects		Check Operation	
Wheels Studs/Rims		Hydraulics-MB	OK Attended To
Engine & Cooling	OK Attended To	Check Filter	
Change Oil - Engine	JM/RT/MF	Hydraulic Hoses/Fittings	
Change Oil & Fuel Filters		PTO Shaft	
Change Service Decal		Hydraulic Leaks & Levels	
Air Filters Check	Remove + Replace	Safety Accessories	OK Attended To
Complete Grease Job		Fire Extinguisher/First Aid/Triangles	
Windshield Washer Fluids		Hose Certs #1	
Coolant Levels/Fittings/Hoses		#2	
Exhaust Pipe, Muffler		#3	
Engine Controls		JSA/MSDS/Safety Manual	
Fuel Lines/Fittings		CVIP	
Engine Leaks/Hoses		Tank Inspection Status: _____	
Mechanical Attachments	OK Attended To	Vac/Water System Check	OK Attended To
Auxiliary Equipment Fluid Levels		Vac Filters	✓ MF
Filters		Cyclone	
Check Operation		ESD Functionality	
Electrical Components	OK Attended To	Rear Valves	
Back Up System & Horn		Air Switches	
Batteries		Cyclone Seal	
Heating & Defrosting Systems		Rear Door Seal	
Horn		Pressure/Vac Handle	
Lamps Lights & Reflectors & Flashers		Triplex Check	
Neutral Safety Starting Switch	✓ JM	Roper Pump	
Speedometer		Hibon Oil Levels	
Windshield Wiper & Washers		System Leakage?	
Steering & Suspension	OK Attended To	Grease Axillary Components	
Front Suspension & Rear Suspension		Wash Pump	
Steering Column & Box		Pressure Test Water System	
Wheel Alignment & Steering Linkage		Packing Check	
Air Suspension		General Electrical/Inverter Check	
Power Steering Fluid Level/Hoses	✓ Gasket RT	Boiler Fuel Pressure	
Steer Hub Oil Levels/Caps			

AXLE

Push
Rod
Travel

Push
Rod
Travel

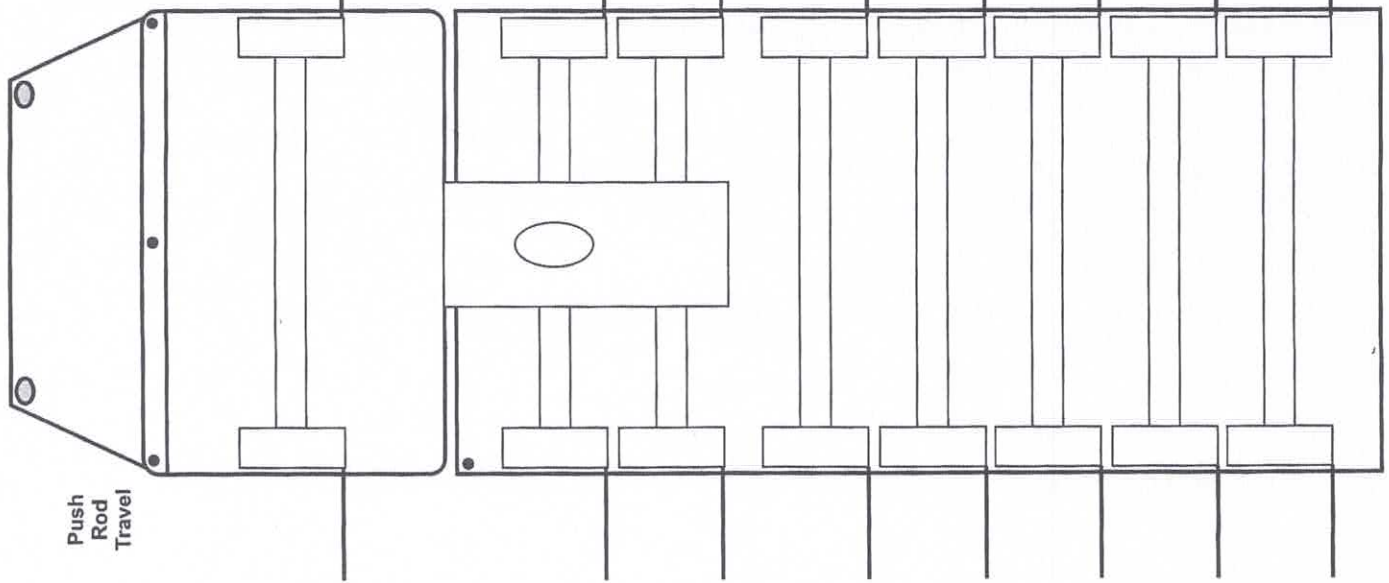

Comments:

Engine Removal + Replacement

Dawco Check Valve

Fan belt #01-32731-635

Clutch Replacement

AC Belt #8PK2691

Power Steering Gasket

Air Comp. Replacement

Starter Replacement

Engine Serial #

LH RR Airbag replacement

1F0JGLDRXDLFD6962

Air filter replacement

Air filter housing Bushings

Clutch slave cylinder

Bleed Clutch System

filter replacement - Oil + fuel

Thermostat replaced

Reinstall hood

Recharge A/C

Fill all fluids


Date: _____ Mechanic: _____ Signature: _____

Done

Date: June 19/2005 Unit# 02-39 SN: 1FUT6LRS5T2041 Hours: 31475 Mileage: 1342703

1.	Initials	Job Description	23.	Initials	Job Description
2.			24.	JM	Prime fuel system
3.	JM/KM	Engine Remove/Replace	25.	JM	Start engine and monitor
4.	RT	Carbo check Valve	26.	JM	Secure/Repair Drivers stop
5.	JM	Clutch Replacement	27.	JM	cable on passengers side frame
6.	JM	input shaft Replacement	28.	JM/KT	Retorque tires
7.	RT	Power steering gasket for comp Replacement	29.	JM	oil Drain Replacement
8.	JM	Starter Replacement	30.	RT	"wheel" on Rad
9.	JM	LHR Air bag Replacement	31.	JM	Air dryer cartridge Replacement
10.	JM	Air Filter Replacement	32.	JM	Air purge Valve
11.	JM	AV Filter Housing Bushings	33.	JM	Diagnose Fuel Tester
12.	JM	check Trans Idle	34.	JM	pressure Bleed Clutch
13.	JM	clutch slave cylinder	35.	JM	Diagnose Front marker lamp
14.	JM	Bleed clutch system	36.	JM	Reassemble interior
15.	JM	oil Filter Replacement	37.	RT	Road test and monitor
16.	JM	Fuel Filter Replacement	38.	JM	Diagnose ABS faults
17.	JM	Thermostat Replacement	39.	JM	Fan Belt# 01-32731-635
18.	JM	Transmission covers	40.	JM	AC Belt# 8PK2691
19.	JM	Reinstall Hood	41.	JM	Diagnose Fan always "on"
20.	JM	Recharge AC system	42.	JM	Remove and Replace Fan clutch
21.	JM	Fill coolant system	43.	JM	
22.	JM		44.	JM	

Date: Feb 27/25		Unit: 0239		S/N:	Mileage: 1342280	Hours: 31464
Frame/Cab & Body	OK	Attended To		Brake/Wheel/Hub & Air System	OK	Attended To
Fuel Tanks & Cap				Brake Friction Components	✓	DH
Fifth Wheel/Trailer Connecting Devices				Air Brake Components	✓	
Decals (GVW, Tare, Logo)				Air Dryer/Air Hoses/Air Fittings	✓	
Body				Brake Pedal	✓	
Doors, Latches	✓	DVO		Air Brake System	✓	
Mud Flaps				Parking Brake	✓	
Windshield, Windows, Mirrors				Emergency Brake	✓	
Check Underbody				Service Brake	✓	
Hangar Brackets				Wheel Bearing	✓	
Frame				Set Brakes & Check Operation	✓	
Bumpers & Fenders				Drive Train/Transmission & Diff.	OK	Attended To
Tires	OK	Attended To		U Joints	✓	DVO
Depth of Tread				Transmission Level/Hoses	✓	DVO
Tread Defects				Transmissions/Differentials	✓	DVO
Sidewall Defects				Check Linkages	✓	DVO
Recapping				Drive Shaft	✓	DVO
Sidewall Defects				Check Operation	✓	DVO
Wheels Studs/Rims				Hydraulics-MB	OK	Attended To
Engine & Cooling	OK	Attended To		Check Filter		
Change Oil - Engine	✓	DH		Hydraulic Hoses/Fittings		
Change Oil & Fuel Filters	✓	DH RT		PTO Shaft	✓	RT
Change Service Decal	✓	DH		Hydraulic Leaks & Levels		
Air Filters Check	✓	DH		Safety Accessories	OK	Attended To
Complete Grease Job				Fire Extinguisher/First Aid/Triangles		
Windshield Washer Fluids	✓	DH		Hose Certs #1		
Coolant Levels/Fittings/Hoses	✓	DH		#2		
Exhaust Pipe, Muffler				#3		
Engine Controls				JSA/MSDS/Safety Manual		
Fuel Lines/Fittings				CVIP		
Engine Leaks/Hoses				Tank Inspection Status: _____		
Mechanical Attachments	OK	Attended To		Vac/Water System Check	OK	Attended To
Auxiliary Equipment Fluid Levels				Vac Filters		
Filters				Cyclone		
Check Operation				ESD Functionality		
Electrical Components	OK	Attended To		Rear Valves		
Back Up System & Horn				Air Switches		
Batteries				Cyclone Seal		
Heating & Defrosting Systems				Rear Door Seal		
Horn				Pressure/Vac Handle		
Lamps Lights & Reflectors & Flashers	✓	RT		Triplex Check		
Neutral Safety Starting Switch				Roper Pump		
Speedometer				Hibon Oil Levels		
Windshield Wiper & Washers				System Leakage?		
Steering & Suspension	OK	Attended To		Grease Axillary Components		
Front Suspension & Rear Suspension				Wash Pump		
Steering Column & Box				Pressure Test Water System		
Wheel Alignment & Steering Linkage				Packing Check		
Air Suspension				General Electrical/Invertor Check		
Power Steering Fluid Level/Hoses				Boiler Fuel Pressure		
Steer Hub Oil Levels/Caps						

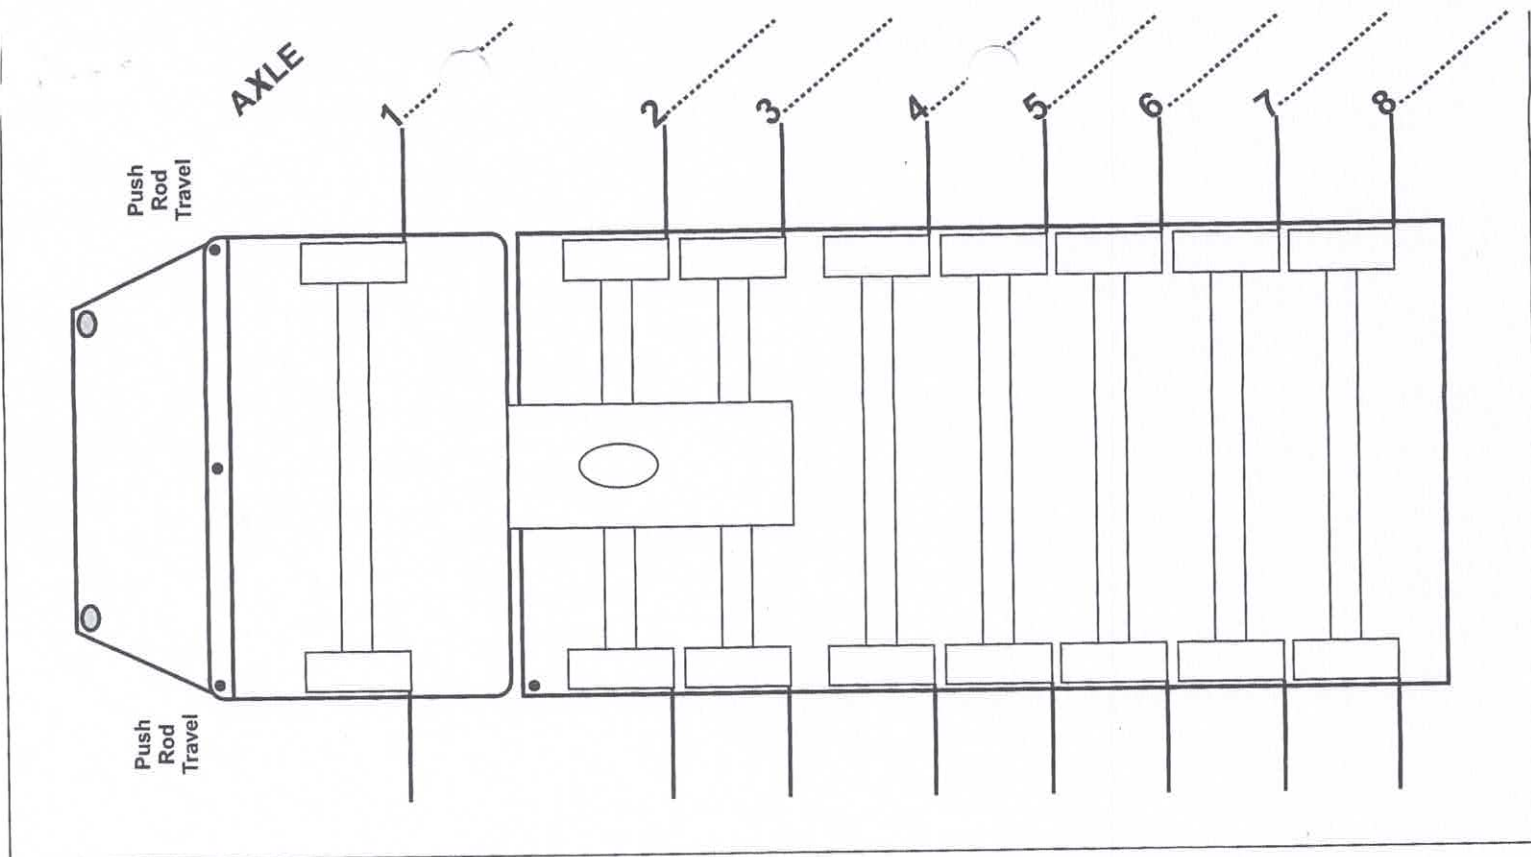

Comments:

All brakes on rear done

Backing Plates x 6

Pump Installation

2 way radio install

Replaced door latch DS

Cheet Belts

RH tie rod end + LH tie rod end R+R

Finished delete on DPF

Removed Flap Intake/Weld closed

~~Replaced~~ Cab Filter replaced

Re torqued wheels

Replaced driver door Hinges

Repaired Trailer Plug

Date: _____ Mechanic: _____ Signature: _____

Date: Feb 27/25 Unit# QA-39 SN: 1E15AK DR 305A12046 hours: 31464 Mileage: ~~1342280~~

1.	Initials	Job Description	23.	Initials	Job Description
2.	DH	oil change & filters	24.		
3.	DH	Air Filters	25.		
4.	DH	All brakes on rear done	26.		
5.	R/DH	Backing Plates x 6	27.		
6.	DH/R	Pump Installation	28.		
7.	RT	PTO	29.		
8.	DH	2 way Radio Install	30.		
9.	RT	Change Fuel Filters	31.		
10.	DH	checked diff levels	32.		
11.	DH	checked Trans Fluid level	33.		
12.	DH	Replaced door switch Driver door	34.		
13.	DH	check Belts	35.		
14.	DH	Driver side Hinges	36.		
15.	DR DH	RT Tire Rod End & LH Tire Rod End	37.		
16.	DR	Finished delete on DPF	38.		
17.	DH	Removed flap on Intake	39.		
18.	DH	Weld door	40.		
19.	DH	Cab Filter Replaced	41.		
20.	RT DH	Replaced wheels	42.		
21.	RT DH	Replace Driver Door Hinges	43.		
22.	RT	Repair Trailer Plug	44.		

1342280