

FREELAND CDJR.COM

CHRYSLER DODGE JEEP RAM

Nashville

5800 Crossings Blvd
Antioch, TN 37013
(615) 696-4000

SERVICE DEPARTMENT HOURS
7:00 a.m. to 6:00 p.m.
Monday - Friday
7:00 a.m. to 3:00 p.m. Saturday

R/O Open Date	R/O Number
11/28/22	6088810/1
R/O Close Date	Status
11/30/22	Pre-Invoice
Mileage In	Mileage Out
35749	35753
Service Advisor / Tag #	
KRISTEN MCCULLO/9748	
Vehicle Identification Number	
3C7WRNAL0JG128437	
Delivery Date	In-Service Date
03/12/20	03/12/20
Color	License Number
BRIGHT WHI	

THORNE EXCAVATING COMPANY- LLC
624 OLD HORN SPRINGS RD
LEBANON, TN 37087-1811

Year	Make	Model	Body	Work Phone	Home Phone
2018	RAM	5500 CHASSIS	SLT 4X4 REG CAB 6	615-337-8170	
FC1156					

DESCRIPTION OF SERVICE AND PARTS	AMOUNT
Cell: 615-337-8170	
#1 - I: INFORMATION ONLY GENERAL CONCERN [CUSTOMER STATES THAT THE ABS LIGHT KEEPS COMING ON AND OFF PLEASE ADVISE SOP HERE] Caused by c/s ABS lamp keeps coming on, HCU ordered 9/10/22 has fault C0021 diag. per service info needs HCU Corrected by Tech: KEITH BOLINGER (102) Corrected by Tech: KEITH BOLINGER (102) Installed 68347099AB :MODULE: ANTI-LOCK BRAKE SYST Qty: 1 Installed 4318080AD :FLUID: BRAKE Qty: 2 Installed 68195569AB :CONTROL: ANTI-LOCK BRAKE SYS Qty: 1 replaced HCU & bleed brakes, after short test drive lamp back on same fault. diagnostics state to replace HCU & if fault returns to replace module replaced & programed module NPF 05400704 [1.7] HCU 08191033 [1.0] module	Warranty Warranty Warranty Warranty
#2 - MIS: SUGGESTED SERVICE FROM FCA MULTI-POINT INSPECTION (ACCORDING TO MAINTENANCE INTERVAL) #0112 18' Ram 5500	
TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto." DISCLAIMER OF WARRANTIES. Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.	LABOR PARTS DEDUCTIBLE SUBLET SHOP SUPPLIES HAZARDOUS MATERIALS SALES TAX OR TAX I.D. SPECIAL ORDER DEPOSIT DISCOUNTS TOTAL DUE
NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.	
X	

FREELAND CDJR.COM

CHRYSLER DODGE JEEP RAM

Nashville

5800 Crossings Blvd
Antioch, TN 37013
(615) 696-4000

SERVICE DEPARTMENT HOURS
7:00 a.m. to 6:00 p.m.
Monday - Friday
7:00 a.m. to 3:00 p.m. Saturday

R/O Open Date	R/O Number
11/28/22	6088810/2
R/O Close Date	Status
11/30/22	Pre-Invoice
Mileage In	Mileage Out
35749	35753
Service Advisor / Tag #	
KRISTEN MCCULLO/9748	

THORNE EXCAVATING COMPANY- LLC 624 OLD HORN SPRINGS RD LEBANON, TN 37087-1811			Work Phone	Vehicle Identification Number	
			Home Phone	3C7WRNAL0JG128437	
			615-337-8170	Delivery Date	In-Service Date
				03/12/20	03/12/20
Year	Make	Model	Body	Color	License Number
2018	RAM	5500 CHASSIS	SLT 4X4 REG CAB 6	BRIGHT WHI	
FC1156					

DESCRIPTION OF SERVICE AND PARTS	AMOUNT
Sub Total: .00	
***** * WITHOUT YOUR BUSINESS...WE HAVE NO BUSINESS. THANK * * YOU!!!! CUSTOMER SATISFACTION IS OUR #1 PRIORITY! * * SERVICE DEPT. GUESTS MAY RECEIVE A SURVEY IN YOUR * * E-MAIL. OUR GOAL IS 10'S & YES! * *****	
TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."	
DISCLAIMER OF WARRANTIES. Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.	
LABOR	.00
PARTS	.00
DEDUCTIBLE	.00
SUBLET	.00
SHOP SUPPLIES	.00
HAZARDOUS MATERIALS	.00
SALES TAX OR TAX I.D.	.00
SPECIAL ORDER DEPOSIT	.00
DISCOUNTS	.00
TOTAL DUE	.00
NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.	
X	

5800 Crossings Blvd
Antioch, TN 37013
(615) 866-6060

SERVICE DEPARTMENT HOURS
7:00 a.m. to 6:00 p.m.
Monday - Friday
7:00 a.m. to 3:00 p.m. Saturday

R/O Open Date	R/O Number
9/18/20 07:10	6053653/1
R/O Close Date	Status
9/24/20	Pre-Invoice
Mileage In	Mileage Out
10950	10956
Service Advisor / Tag #	
RACHEL SUMMERLI / 5221	

THORNE EXCAVATING COMPANY- LLC
624 OLD HORN SPRINGS RD.
LEBANON, TN 37087

Work Phone	Vehicle Identification Number
	3C7WRNAL0JG128437
Home Phone	Delivery Date
615-444-5142	3/12/20
Body	In-Service Date
SLT 4X4 REG CAB 6	3/12/20
Color	License Number
BRIGHT WHI	

Year	Make	Model
2018	RAM	5500 CHASSIS
FC1156		

DESCRIPTION OF SERVICE AND PARTS	AMOUNT
#1 - MIS: SUGGESTED SERVICE FROM FCA Z- (DMS APPT. FEED) LINE 1 [GUEST STATES THE CHECK ABS LIGHT IS FLASHING AND THE CRUISE CONTROL IS NOT WANTING TO WORK- PLEASE ADVISE] Caused by c/s ABS lamp is on,,, check out found C0020-01 diag. per service info no other faults service info states to replace HCU , Tech: KEITH BOLINGER (102) Corrected by Tech: KEITH BOLINGER (102) Installed 68195569AA :CONTROL: ANTI-LOCK BRAKE SYS Qty: 1 (OEM) Installed 4318080AD :FLUID: BRAKE Qty: 2 (OEM) replaced HCU & bleed brakes test drive NPF 05400701[1.1]	Warranty Warranty Warranty Warranty
#2 - MIS: SUGGESTED SERVICE FROM FCA Z- (DMS APPT. FEED) LINE 2 [GUEST NEEDS DIAG BY EOD IF POSSIBLE] Sub Total: .00	#0112 18' Ram 5500
#3 * I: INFORMATION ONLY ADDED OPERATION called @ 1104 9/18/2020	

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES. Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

LABOR	
PARTS	
DEDUCTIBLE	
SUBLET	
SHOP SUPPLIES	
HAZARDOUS MATERIALS	
SALES TAX OR TAX I.D.	
SPECIAL ORDER DEPOSIT	
DISCOUNTS	
TOTAL DUE	

FREELAND **CDJR.COM** CHRYSLER DODGE JEEP RAM *Nashville*

5800 Crossings Blvd
 Antioch, TN 37013
 (615) 866-6060

SERVICE DEPARTMENT HOURS
 7:00 a.m. to 6:00 p.m.
 Monday - Friday
 7:00 a.m. to 3:00 p.m. Saturday

R/O Open Date	R/O Number
9/18/20 07:10	6053653/2
R/O Close Date	Status
9/24/20	Pre-Invoice
Mileage In	Mileage Out
10950	10956
Service Advisor / Tag #	
RACHEL SUMMERLI/5221	

THORNE EXCAVATING COMPANY- LLC
 624 OLD HORN SPRINGS RD.
 LEBANON, TN 37087

Work Phone	Vehicle Identification Number
	3C7WRNAL0JG128437
Home Phone	Delivery Date
615-444-5142	3/12/20
Body	In-Service Date
SLT 4X4 REG CAB 6	3/12/20
	Color
	BRIGHT WHI
	License Number

Year	Make	Model
2018	RAM	5500 CHASSIS
FC1156		

DESCRIPTION OF SERVICE AND PARTS

updated @ 0714 9/22/2020
 updated @ 1503 9/24/2020
 Sub Total: .00

AMOUNT

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES. Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

LABOR	.00
PARTS	.00
DEDUCTIBLE	.00
SUBLET	.00
SHOP SUPPLIES	.00
HAZARDOUS MATERIALS	.00
SALES TAX OR TAX I.D.	.00
SPECIAL ORDER DEPOSIT	.00
DISCOUNTS	.00
TOTAL DUE	.00

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.

X

FREELAND CDJR.COM

CHRYSLER DODGE JEEP RAM

Nashville

5800 Crossings Blvd
Antioch, TN 37013
(615) 696-4000

SERVICE DEPARTMENT HOURS
7:00 a.m. to 6:00 p.m.
Monday - Friday
7:00 a.m. to 3:00 p.m. Saturday

R/O Open Date	R/O Number
11/28/22	6088810/1
R/O Close Date	Status
11/30/22	Pre-Invoice
Mileage In	Mileage Out
35749	35753
Service Advisor / Tag #	
KRISTEN MCCULLO/9748	

THORNE EXCAVATING COMPANY- LLC
624 OLD HORN SPRINGS RD
LEBANON, TN 37087-1811

THORNE EXCAVATING COMPANY- LLC 624 OLD HORN SPRINGS RD LEBANON, TN 37087-1811			Work Phone	Vehicle Identification Number			
				3C7WRNAL0JG128437			
			Home Phone	Delivery Date		In-Service Date	
			615-337-8170	03/12/20		03/12/20	
Year	Make	Model	Body	Color	License Number		
2018	RAM	5500 CHASSIS	SLT 4X4 REG CAB 6	BRIGHT WHI			
FC1156							

DESCRIPTION OF SERVICE AND PARTS	AMOUNT
Cell: 615-337-8170	
#1 - I: INFORMATION ONLY GENERAL CONCERN [CUSTOMER STATES THAT THE ABS LIGHT KEEPS COMING ON AND OFF PLEASE ADVISE SOP HERE] Caused by c/s ABS lamp keeps coming on, HCU ordered 9/10/22 has fault C0021 diag. per service info needs HCU Corrected by Tech: KEITH BOLINGER (102) Corrected by Tech: KEITH BOLINGER (102) Installed 68347099AB :MODULE: ANTI-LOCK BRAKE SYST Qty: 1 Installed 4318080AD :FLUID: BRAKE Qty: 2 Installed 68195569AB :CONTROL: ANTI-LOCK BRAKE SYS Qty: 1 replaced HCU & bleed brakes, after short test drive lamp back on same fault. diagnostics state to replace HCU & if fault returns to replace module replaced & programed module NPF 05400704 [1.7] HCU 08191033 [1.0] module	Warranty Warranty Warranty Warranty
#2 - MIS: SUGGESTED SERVICE FROM FCA MULTI-POINT INSPECTION (ACCORDING TO MAINTENANCE INTERVAL) #0112 18' Ram 5500	
TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto." DISCLAIMER OF WARRANTIES. Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.	LABOR PARTS DEDUCTIBLE SUBLET SHOP SUPPLIES HAZARDOUS MATERIALS SALES TAX OR TAX I.D. SPECIAL ORDER DEPOSIT DISCOUNTS TOTAL DUE
NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.	
X	

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0112

MAKE Ram

MODEL 18' 8500 HD

SERIAL # _____

HOUR METER _____

MILES 200 mi.

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____

REASON

PARTS _____ LABOR _____

OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS

POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER

OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED

OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH

SMOKES SHORTED VIBRATE OTHER _____

DATE: 3-12-2020 DATE COMPLETED 3-17-2020

MECHANIC All

JOB NAME/LOCATION

JOB NUMBER

Shop

PROBLEM: New Truck

REPAIRED: red decals

Installed safety light

Installed Brake controller

set up

PARTS: Triangles 27.52

rotating light 298.90

Wheel chocks 39.00

Jumper cables 33.00

Brake controller 240.35

Truck Pro

Trucker's lighthouse

Fleet pride

Autozone

The Trailer Depot

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0112
 MAKE Ram
 MODEL 18' 5500
 SERIAL # _____
 HOUR METER _____
 MILES 20K mi

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____
 REASON _____
 PARTS _____ LABOR _____
 OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS
 POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER

OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED

OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH

SMOKES SHORTED VIBRATE OTHER _____

DATE: _____ DATE COMPLETED 6-10-21

MECHANIC Swider

JOB NAME/LOCATION

Swider

JOB NUMBER

PROBLEM: _____

REPAIRED: replaced steer tires serviced

PARTS 2- steer Tires 864. 5L Swider Fleet solutions
Mich XZE 225/70R-19.5

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0112
 MAKE Ram
 MODEL 18' 5500
 SERIAL # _____
 HOUR METER _____
 MILES 20k mi

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____
 REASON _____
 PARTS _____ LABOR _____
 OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS
 POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER
 OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED
 OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH
 SMOKES SHORTED VIBRATE OTHER _____

DATE: _____ DATE COMPLETED 7-15-21

MECHANIC James

JOB NAME/LOCATION

JOB NUMBER

PROBLEM: front end alignment & mirror

REPAIRED: Alignment & Driver mirror

PARTS: Alignment \$117.18 Swivel Fleet
Mirror \$171.00 Premier Ram

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0112
 MAKE Ram
 MODEL 18' 5500
 SERIAL # _____
 HOUR METER _____
 MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____
 REASON _____
 PARTS _____ LABOR _____
 OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS
 POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER
 OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED
 OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH
 SMOKES SHORTED VIBRATE OTHER _____

DATE: _____ DATE COMPLETED 8-1-22

MECHANIC James

JOB NAME/LOCATION

Shop

JOB NUMBER

PROBLEM: needs batteries

REPAIRED: replaced batteries

PARTS: 2-MTP. 94R 346.70

Interstate battery

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0112

MAKE Ram

MODEL 18' 5500

SERIAL # _____

HOUR METER _____

MILES 45k mi

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____

REASON _____

PARTS _____ LABOR _____

OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS

POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER

OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED

OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH

SMOKES SHORTED VIBRATE OTHER _____

DATE: _____ DATE COMPLETED 8-10-23

MECHANIC Tire shop

JOB NAME/LOCATION

Gateway Gallatin

JOB NUMBER

PROBLEM: needs rear tires

REPAIRED: new rear tires

PARTS: 4- 225/70R 19.5 Hankook 1744 81 Gateway Tire

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION

EQUIP. # 0112

MAKE Ram

MODEL 18' 5500

SERIAL # _____

HOURLY METER _____

MILES _____

EQUIPMENT DOWNTIME

HOURS _____ DAYS _____

REASON

PARTS _____ LABOR _____

OTHER _____

COMPONENT CODES

BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS

POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED

COMPONENT LOCATION

FRONT REAR LEFT RIGHT UPPER LOWER

OTHER _____

REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED

OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH

SMOKES SHORTED VIBRATE OTHER _____

DATE: _____ DATE COMPLETED 1-24-24

MECHANIC All

JOB NAME/LOCATION

All shops

JOB NUMBER

PROBLEM: Fuel leak

REPAIRED: replaced tank module

PARTS: Module & O-ring 603.79 MT Juliet Ram

TEC

THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION		EQUIPMENT DOWNTIME		COMPONENT CODES	
EQUIP. # <u>0112</u>		HOURS _____ DAYS _____		BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS	
MAKE <u>Ram</u>		REASON		POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED	
MODEL <u>18' 5500</u>		PARTS LABOR		COMPONENT LOCATION	
SERIAL # _____		OTHER _____		FRONT REAR LEFT RIGHT UPPER LOWER	
HOUR METER _____				OTHER _____	
MILES <u>68k mi</u>					
REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED				DATE: <u>5-9-25</u> DATE COMPLETED <u>5-9-25</u>	
OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH				MECHANIC <u>AIL</u>	
SMOKES SHORTED VIBRATE OTHER _____				JOB NAME/LOCATION	
				<u>Shop</u>	
				JOB NUMBER	

PROBLEM: pedal position failure

REPAIRED: replaced pedal sensor assembly
MT Juliet Ram Marshes system.

PARTS: pedal 297.⁶³ MT Juliet Ram.
flash system 150.⁰⁰ MT Juliet Ram

TEC



THORNE'S EXCAVATING COMPANY, LLC

SINCE 1963

EQUIPMENT INFORMATION EQUIP. # <u>0112</u> MAKE <u>Ram</u> MODEL <u>18' 5500</u> SERIAL # _____ HOUR METER _____ MILES <u>72,407 mi</u>	EQUIPMENT DOWNTIME HOURS _____ DAYS _____ REASON _____ PARTS _____ LABOR _____ OTHER _____	COMPONENT CODES BASIC MACHINE HYDRAULIC ENGINE IMPLEMENTS POWER TRAIN ELECTRIC DRIVE TRAIN UNEXPLAINED COMPONENT LOCATION FRONT REAR LEFT RIGHT UPPER LOWER OTHER _____
REASON FOR FAILURE: BROKEN WORN ABUSE LOOSE SEIZED OVERHEAT PLANNED CONTAM LEAKING NOISY SCRATCH SMOKES SHORTED VIBRATE OTHER _____	DATE: _____ DATE COMPLETED <u>9-3-25</u> MECHANIC <u>Snider Tire</u> JOB NAME/LOCATION <u>Snider Tire</u> JOB NUMBER _____	
PROBLEM: <u>needs tires</u>		
REPAIRED: <u>replaced all six tires</u>		
PARTS: <u>6-Tires Mount & Valve 3,394.00</u> <u>Snider Tires</u> <u>225/70 R. 19.5</u>		

Toolbox Mounting Instructions

Please read these instructions and warnings before installation.

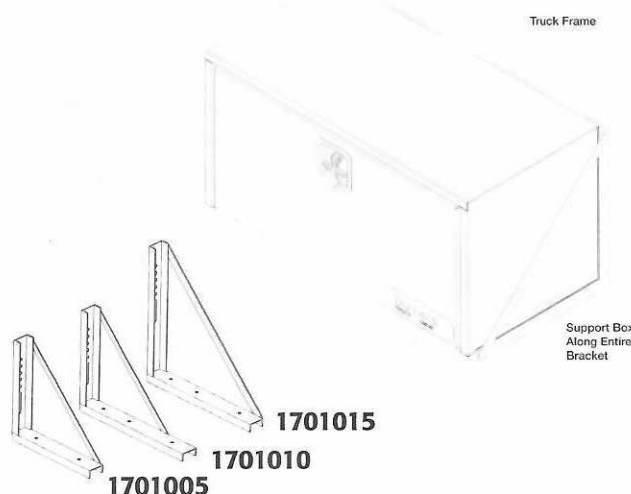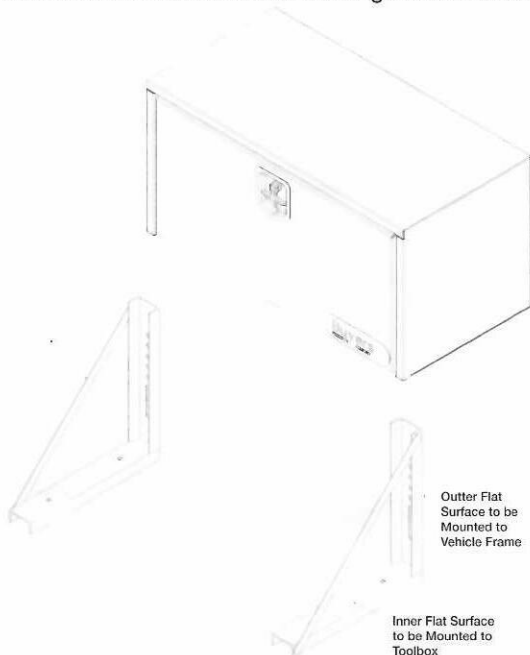

DANGER

Do not use this toolbox for the storage or transportation of flammables, explosives, hazardous waste or materials such as gasoline, solvents, gun powder, dynamite, propane tanks, acetylene tanks or cutting torches. This toolbox is only intended and safe for use in storing and transporting small tools and equipment and/or other materials.

WARNING

1. If the proper mounting brackets are not used, the toolbox could drop off the vehicle while it is moving and cause personal injury and/or property damage.
2. Mounting your toolbox through the top, back or sides without bottom support will significantly reduce the capacity and possibly the life of the toolbox.
3. Prior to any welding or drilling holes in a vehicle frame, check for location of fuel tanks, fuel lines, brake lines or electrical wires.
4. If welding is to be done on a vehicle frame in the mounting of this toolbox, disconnect the cables from the battery to prevent shorting of electrical components on the vehicle.
5. Always wear protective eyewear when drilling, welding or checking the underside of a vehicle.

To properly support your Underbody Toolbox, we recommend the use of bottom support mounting brackets. These brackets should be placed so that each end of the toolbox is supported by the full width of the mounting bracket. To prevent rust, touch-up drilled holes with aerosol paint. To prevent water leaks, apply silicone sealant all around each fastener after installation.

PART NO.	QTY.	DESCRIPTION
1701005	One Pair of	18" x 18" Structural Welded Brackets
1701010	One Pair of	18" x 24" Structural Welded Brackets
1701015	One Pair of	24" x 24" Structural Welded Brackets
1701005B	One Pair of	18" x 18" Structural Bolted Brackets
1701010B	One Pair of	18" x 24" Structural Bolted Brackets
1701006	One Pair of	18" x 18" Formed Welded Brackets
1701011	One Pair of	18" x 24" Formed Welded Brackets
1701016	One Pair of	24" x 24" Formed Welded Brackets
1701006B	One Pair of	18" x 18" Formed Bolted Brackets
1701011B	One Pair of	18" x 24" Formed Bolted Brackets
1701030	One Pair of	18" x 18" Aluminum Brackets
1701040	One Pair of	24" x 24" Aluminum Brackets
1701031	One Pair of	18" x 18" Stainless Brackets
1701041	One Pair of	18" x 24" Stainless Brackets

WARRANTY

Buyers Products Co. warrants all truck/trailer hardware manufactured or distributed by it, to be free from defects in material and workmanship for a period of one year from date of shipment. Parts must be properly installed and used under normal conditions. Any product which has been altered, including modification, misuse, accident or lack of maintenance will not be considered under warranty. Normal wear is excluded. The sole responsibility of Buyers Products Co. under this warranty is limited to repairing or replacing any part or parts which are returned, prepaid, and are found to be defective by Buyers Products Co. Authorization from Buyers Products Co. must be obtained before returning any part. No charges for transportation or labor performed on Buyers' products will be allowed under this warranty.